


## K-60 HS (CanusaTube™)

### Tubular sleeve for protection of Tyton joints

#### Product Description

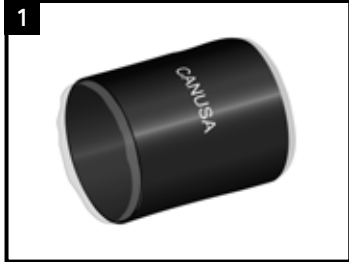


K-60 HS (CanusaTube™) are shipped with an inner release liner for protection from contamination.

#### Equipment List



Propane tank, hose, torch & regulator; Appropriate tools for surface abrasion; Knife, roller, rags & approved solvent cleanser; Digital thermometer with suitable probe; Standard safety equipment; gloves, goggles, hard hat, etc.


#### Surface Preparation

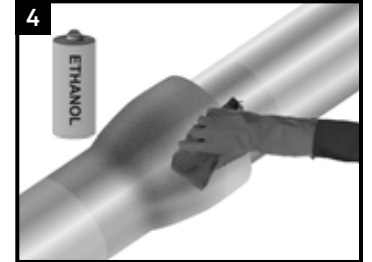

Ensure that the coating edges are beveled to 30°. Clean exposed steel and adjacent pipe coating with a solvent cleanser to remove the presence of oil, grease, and other contaminants.


1

2

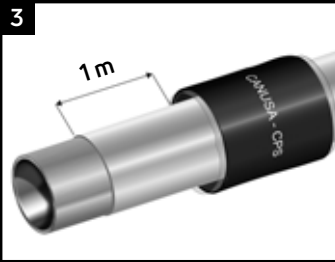


Prior to fitting together the Tyton joint, slide the CanusaTube sleeve at least 1 m away from the cutback area of the joint.

4

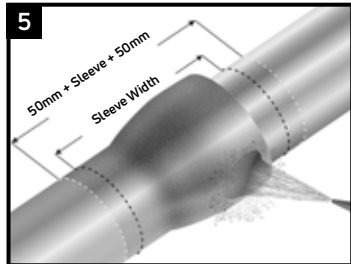


Ensure that the pipe is dry before cleaning. Prepare the steel joint area to a minimum of St2 / SP2. Lightly abrade the pipe coating adjacent to the weld area to a distance of 50mm (2") beyond each end of the sleeve width.

6

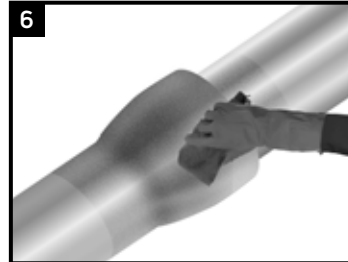

Wipe clean or air blast the steel and pipe coating to remove foreign contaminants.

#### Flame Intensity & Torch Size

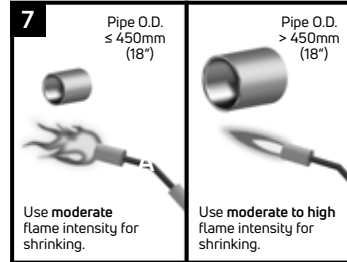

Pipe O.D.  $\leq$  450mm (18")

Use moderate flame intensity for shrinking.


Minimum Torch Size: 150,000 BTU/hr.

Pipe O.D.  $>$  450mm (18")

Use moderate to high flame intensity for shrinking.


Minimum Torch Size: 300,000 BTU/hr.

#### Pre-Heat

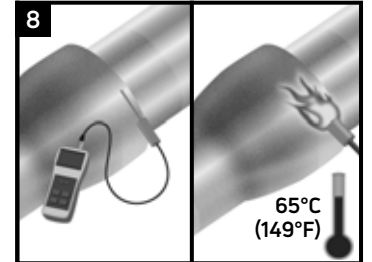


Pre-heat the joint area to a minimum of 65°C (149°F). Using a temperature measuring device, ensure that the correct temperature is reached on the steel and at least 50 mm (2") on each side of the sleeve.


#### Sleeve Installation

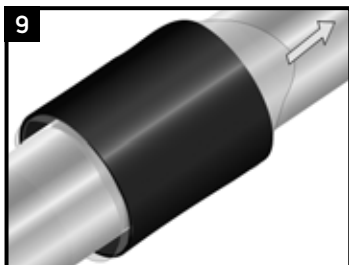


Slide the tube onto the steel joint area, positioning the weld seam at the 12 o'clock position. Centre the tube to ensure a minimum 50 mm (2") overlap onto the pipe coating. Remove the inner release liner.

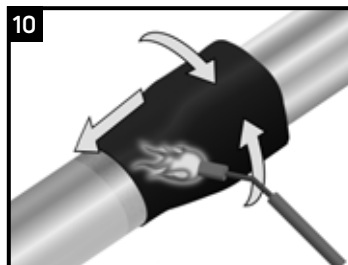


Using the appropriate sized torch, begin shrinking the larger diameter portion of the joint circumferentially around the pipe. Use broad strokes. Continue heating from the centre toward one end of the sleeve until recovery is complete.

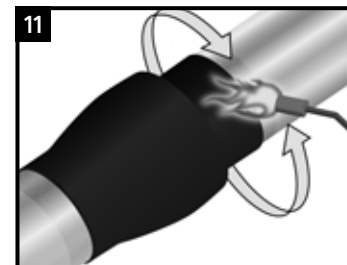

In a similar manner, heat and shrink the smaller diameter side from the centre towards the remaining end until recovery is complete. If necessary, use a gloved hand at the step down to assist recovery and minimize air entrapment.

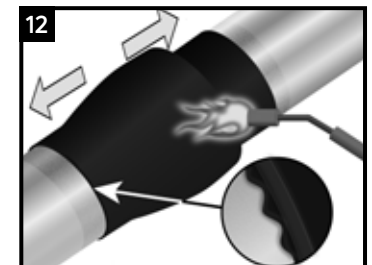


Shrinking has been completed when the adhesive begins to ooze at the sleeve edges all around the circumference. Finish shrinking the sleeve with long horizontal strokes over the entire surface to ensure a uniform bond.

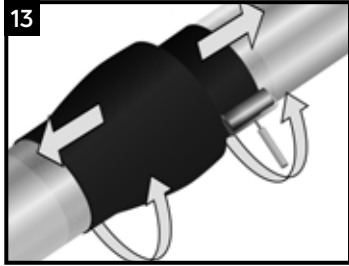


While the sleeve is still hot and soft, use a hand roller to firmly roll the sleeve surface and push any trapped air up and out of the sleeve, as shown above. If necessary, reheat to roll out air.

### Quality Check (Finger Probe Test)

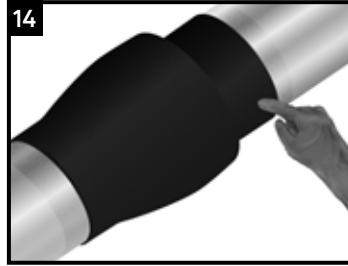

With a gloved hand, press down on the installed sleeve to ensure the backing and sleeve are soft. If there are any cool spots, the sleeve should be reworked with additional heat.

### Inspection

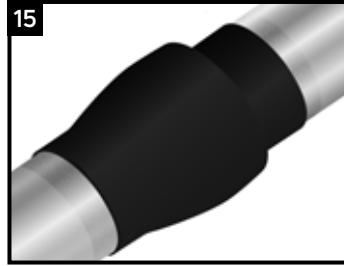

Visually inspect the installed sleeve for the following:

- Sleeve is in full contact with the steel joint.
- Adhesive flows beyond both sleeve edges.
- No cracks or holes in sleeve backing.
- Weld-seam integrity is maintained.

### Storage & Safety Guidelines

To ensure maximum performance, store Canusa products in a dry, ventilated area. Keep products sealed in original cartons and avoid exposure to direct sunlight, rain, snow, dust or other adverse environmental elements. Avoid prolonged storage at temperatures above 35°C (95°F) or below -20°C (-4°F). Product installation should be done in accordance with local health and safety regulations.

These installation instructions are intended as a guide for standard products. Consult your Canusa representative for specific projects or unique applications.

#### Canada

SFL Canusa Canada  
333 Bay Street, Suite 2400  
Toronto ON M5H 2T6, Canada

info@canusacps.com

#### USA

3813A Helios Way, Suite 900  
Pflugerville, TX 78660

info@canusacps.com

#### Europe

Elskensakker 8  
5571 SK Bergeijk  
The Netherlands (NL)

Tel: +31 497 54 25 27

#### Middle East

Plot # 37-WR43, Sector no.: ICAD III  
Musaffah South, PO Box 2621  
Abu Dhabi, United Arab Emirates

Tel: +971 (2) 204 9800

### Quality Management system registered to ISO 9001

Canusa warrants that the product conforms to its chemical and physical description and is appropriate for the use stated on the installation guide when used in compliance with Canusa's written instructions. Since many installation factors are beyond our control, the user shall determine the suitability of the products for the intended use and assume all risks and liabilities in connection therewith. Canusa's liability is stated in the standard terms and conditions of sale. Canusa makes no other warranty either expressed or implied. All information contained in this installation guide is to be used as a guide and is subject to change without notice. This installation guide supersedes all previous installation guides on this product. E&OE

Part No. 99060-269

IG\_K-60 HS\_rev012

### Backfilling Guidelines

After shrinking is complete, allow the sleeve to cool for 2 hours prior to lowering and backfilling. To prevent damage to the sleeve, use selected backfill material, (no sharp stones or large particles). Otherwise, an extruded polyethylene mesh or other suitable shield should be used.